

2021 CAT
D6-20
TRACK TYPE TRACTORS



SALES INFORMATION

Serial #	GZ901047	SMU / Hours	4,252
Status	Used	Rating	As-Is
Availability	Available		

BENEFITS

- Online Owner's Manual

FEATURES

General

- Air Conditioner
- Engine Enclosures
- Product Link
- Air Suspension Seat
- Lighting
- Radio
- Beacon
- Mirrors
- ROPS - Enclosed

Regulatory

- Ultra Low Sulfur Diesel Fuel

Attachments

- Blade Type - S

CONDITION

●●● Good ●● Fair ● Poor

GENERAL CONDITION

Body ●●●	Frame ●●●	General ●●●
ET Product Status Report Download YES	Logged / Active Codes NO	Machine Starts and is Operable YES
S.O.S. (All Compartments) NO Last sampled 30/10/2025 No cause for concern.	Visible Oil Leaks NO	

GENERAL APPEARANCE

Battery Box ●●●	Belly Pans ●●●	Cab or Canopy ●●●
Counterweight ●●●	Decals ●● Missing D6 decals from engine doors. Decals peeling.	Draw Bar ●●●
Engine Enclosures ●●●	Fenders ●●●	Fuel Tank ●●● Fitted with fast fill.
Grab Irons ●●●	Guards ●●●	Hard Nose P&B ●●●
Hood ●●●	Main Frame Welds ●●●	Paint ●●● Good condition, some light scratches to panels and track frames.
Radiator Grill ●●●	Sheet Metal ●●●	Steps / Ladder ●●●
Cleaning Required NO Washed off.		

SAFETY ITEMS

Back Up Alarm
●●●

Camera(s)
●●●
Standard built in reverse camera and 360 camera.

Fire Extinguisher
●●●

Horn
●●●

ROPS
●●●

Seat Belt / Date
●●●

Parking Brake Functioning
YES

ROPS Certification Plate
YES

Safety Decals In Place
YES

Safety Decals Legible
YES

Service Brakes Functioning
YES

OPERATOR STATION

Air Conditioner
●●●

Armrests
●●●

Cab Filter / Heat Vent Louvres
●●●

Dash Console
●●●

Door Latches / Hinges / Seals
●●●

Gauges
●●●

Heater / Defroster
●●●

Hour Meter - GAUGES,
OPERATION STATION,
CONSOLE
●●●

Hydraulic Controls
●●●

Interior Lights
●●●

Interior Plastic / Fabric
●●●

Monitoring Display
●●●

Radio
●●●

Seat Cushions / Suspension /
Type
●●●

Switches
●●●

Transmission Controls
●●●

Windows
●●●

Windshield Wipers
●●●

Current O&MM
YES

ENGINE

Belts / Pulleys - ENGINE
●●●

Engine Oil Level / Condition
●●●

Engine Supports / Mounts
●●●

Exhaust / Muffler / Stack
●●●

Fuel Injection System
●●●

Intake / Air Filters
●●●

Operating Condition - ENGINE
●●●
Machine starts and runs to
satisfactory standard.

Turbocharger / Blower
●●●

Apparent Other Engine
Damage
NO

Blow By
NO

Emissions Decal Legible
YES

Fuel Leaks
NO

Has Engine been rebuilt?
NO

Knocking
NO

Oil Leaks
NO

Water in Oil
NO

Engine S/N
XWE09835

EMISSIONS

Aftertreatment Heat Shields /
Guards
●●●

DEF Lines / Wiring
●●●

Diesel Exhaust Fluid (DEF) Tank
●●●

Diesel Particulate Filter (DPF)
Condition / Service Hours
●●●

Aftertreatment System
Codes
NO

Leaks / Type
NO

COOLING SYSTEM

Anti-Freeze Level / Color /
Condition
●●●

Belts / Pulleys - COOLING
SYSTEM
●●●

Coolers
●●●

Fan
●●●

Fan Shrouds / Guards
●●●

Hoses / Tubes
●●●

Radiator
●●●

Water Pump
●●●

Compression in Radiator
NO

Coolant Leaks
NO

Oil in Anti-Freeze
NO

ELECTRICAL, STARTING AND CHARGING SYSTEM

Alternator ●●●	Batteries / Cables ●●●	Product Link / Condition ●●●
Starter ●●●	Wiring ●●●	Work Lights ●●●

Active Codes
NO
Active GPS codes due to removal of GPS system. Some recent logged codes for : Steering Motor Speed Sensor #2 : Abnormal Frequency, Pulse Width, or Period

TRANSMISSION

Case ●●●	Controls - TRANSMISSION ●●●	Cooler ●●●
Lines / Fittings - TRANSMISSION ●●●	Operating Condition - TRANSMISSION ●●● Machine operates to satisfactory standard in forwards and reverse.	Pump - TRANSMISSION ●●●
Torque Converter (Stall Speed) ●●●	Transmission - Forward Shifts ●●●	Transmission - Reverse Shifts ●●●
Leaks - TRANSMISSION NO	Transmission - Noisy NO	

STEERING

Pump / Motor ●●●	Steering Operating Condition ●●● Steering fully operational.
---------------------	--

BRAKE

Parking Brake Operation ●●●	Service Brake Operation ●●●
--------------------------------	--------------------------------

HYDRAULICS

Control Linkage - HYDRAULICS
●●●●
Good condition, some slight free play but plenty of scope to re-shim.

Hose Lines
●●●●

Hydraulic Valves
●●●●

Lift Cylinders
●●●●

Mounts / Yokes
●●●●

Overall Operating Condition
●●●●

Pumps
●●●●

Tank / Sight Glass / Cap
●●●●

Tilt Cylinder
●●●●

Notes - HYDRAULICS
All hydraulic services fully operational, all cylinders dry and in good condition.

BLADE

Back of Blade
●●●●

Cutting Edge & Bits
●●●●
50% worn, not turned.

Face / Moldboard
●●●●
Blade in good overall condition, face has minimal wear with no dents.

Pins
●●●●

Push Arm
●●●●
Good condition, plenty of scope to re-shim in future.

Spill Rack
●●●●

Trunnions
●●●●

UNDERCARRIAGE


	Measurement (L)	% Worn (L)	Total Potential Hours (L)	Measurement (R)	% Worn (R)	Total Potential Hours (R)
Carrier	194	20				
Rollers Front						
Idlers Front	26	16				
Idlers Rear	25.5	12				
Links	40.1	22				
Pins & Bushings (External)	11.4	32				
Segments		35				
Track Roller 1	43.7	24				

Track Shoe Grouser Height	81	22	
Guiding Guard - Left ●●●		Guiding Guard - Right ●●●	Track Frame - Left ●●●
Track Frame - Right ●●●			
Pins & Bushings Turned? NO			
Average Life Remaining - UNDERCARRIAGE 77% average remaining.		Notes - UNDERCARRIAGE 1 Undercarriage in very good overall condition with no notable issues.	
FINAL DRIVES			
Housings, Left ●●●		Housings, Right ●●●	Planetaries / Differential, Left ●●●
Planetaries / Differential, Right ●●●			
COMMENTS, MISC. REPAIRS, GENERAL REMARKS			
comment 1 Machine in overall good condition with no notable faults.	comment 2 Fully operational unit.	comment 4 Auto Lube System, Fast fill fuel, Reverse Camera, Fire Extinguisher, Bluetooth radio, Air-conditioning, Rear chevrons, High vis decals on handrails, Green SB beacon Amber LED lights front and rear of cab.	
comment 5 Undercarriage in very good overall condition with no notable issues. 77% remaining.			







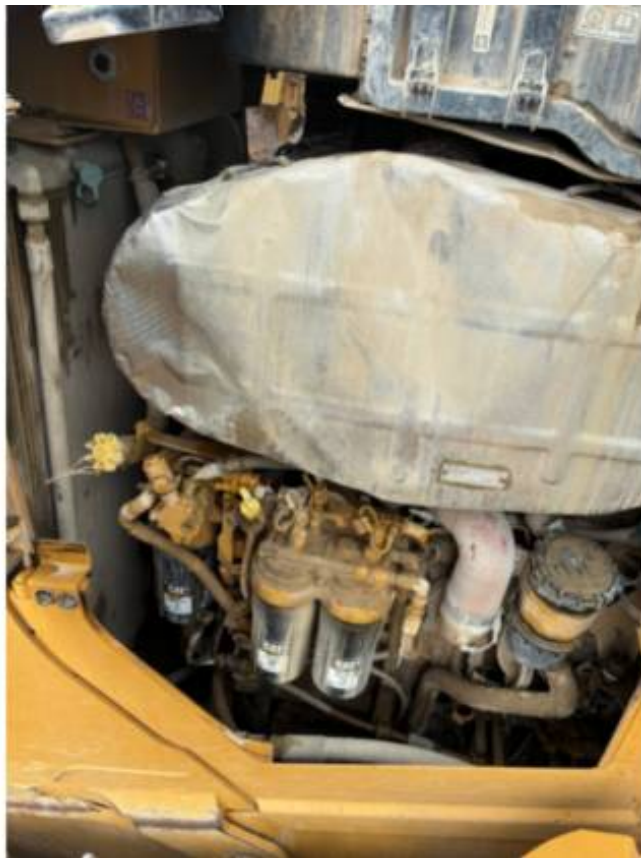

SERVICE INFORMATION	
MODEL NUMBER	
MACHINE 515D	ARRANGEMENT NUMBER 464-5709
SEQUENCE NUMBER *GZ901047*	
ENGINE C9.3B	ARRANGEMENT NUMBER 597-3115
SERIAL *XUE10153*	
TRANSMISSION LUC	ARRANGEMENT NUMBER
PARTS ORDER	
CATERPILLAR INC. PEORIA, IL	











SERVICE INFORMATION	
MODEL NUMBER	
MACHINE	ARRANGEMENT NUMBER
5152	464-5709
SEQUENCE NUMBER	
GZ901047	
ENGINE	ARRANGEMENT NUMBER
60.3B	597-3115
SERIAL	
XUE10103	
TRANSMISSION	ARRANGEMENT NUMBER
LUC	
CATERPILLAR INC. PEORIA, IL	
PARTS ORDER	
ECC-100	



